


SERIAL NUMBERS AND IDENTIFICATION - Continued
ENGINE IDENTIFICATION (EXCEPT LOADMASTER)

Example:

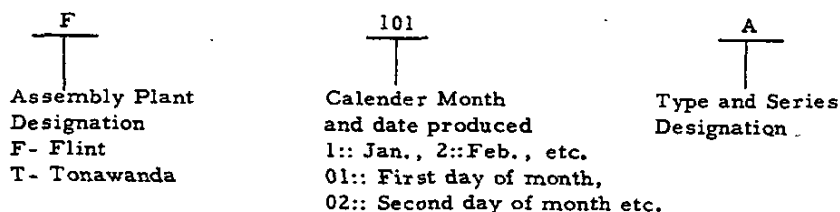


Type and Series Designations

- | | |
|---|--|
| <p>H -3100-3200-3600-3800 regular production
 HD -3100-3200-3600-3800-4000 with RPO 308-314
 L -3100-3200-3600-3800-4000 with RPO 408-409
 LA -3100-3200-3600-3800-4000 RPO 408-409 with RPO 308-314
 LB -3100-3200-3600-3800-4000 RPO 227 with RPO 408-409
 J -3400-3500-3700 Regular Production
 JA -3400-3500-3700 RPO 321
 M -3400-3500-3700 RPO 408
 HE -4000 Regular Production (3100-3200-3600-3800 RPO 227)
 N -5000 Regular Production
 NA -5000 with RPO 310
 NC -5000 with RPO 418
 ND -5000 RPO 418 with RPO 310
 K -6000 Regular Production
 KC -6000 (except 6200-6600) with RPO 309o</p> | <p>P -6000 (except 6200-6600) with RPO 409o
 PA -6000 (except 6200-6600) RPO 409 with RPO 309o
 PC -6000 (except 6200-6600) RPO 409 with RPO 418o
 PD -6000 (except 6200-6600) RPO 409 with RPO 418-309o
 R -7000 Regular Production
 RA -7000 with RPO 310
 RD -7000 with RPO 474
 RE -7000 RPO 474 with RPO 310
 RF -7000 with RPO 418
 RG -7000 RPO 418 with RPO 310
 RH -7000 RPO 418 with RPO 310-474
 RJ -7000 RPO 418 with RPO 474
 S -8000 Regular Production
 SC -8000 with RPO 310
 SD -8000 with RPO 413
 SE -8000 RPO 413 with RPO 310
 SF -8000 with RPO 418
 SG -8000 RPO 418 with RPO 310
 SH -8000 RPO 418 with RPO 413
 SJ -8000 RPO 418 with RPO 310-413</p> |
|---|--|

LOADMASTER ENGINE SERIAL NUMBER

Example:



CS2-9000-10000 Regular Production
 CA2-9000-10000 with RPO 311

CS4-9000-10000 with RPO 418
 CA4-9000-10000 RPO 418 with RPO 311

TRANSMISSION IDENTIFICATION

Three Speed Conventional and Overdrive

Example: M 2 28
 Plant (M-Muncie, S-Saginaw) Month Day of Month

Four Speed Synchromesh

Example: T 2 28
 Plant (T-Toledo) Month Day of Month

Four Speed Automatic

Series 3100-3200 ----- Orange plate color
 Series 34-35-36-3800-4000 ----- Black plate color

Three Speed Heavy Duty

Example: W B 28 2
 Manufacturer † Month* Day of Month Shift

†- W- Borg Warner
 *- A- January, B- February etc.

Five Speed Synchromesh (New Process)

Example: 2 28 7
 Month Day of Month Year

Five Speed Synchromesh Heavy Duty (Spicer)

Example: D B 28 7
 Manufacturer † Month* Day of Month Year

†- Dana Corporation
 *- A-January, B-February, etc.

Six Speed Automatic (Powermatic)o

Series 6000 with 261 cu. in. engine----- Red I.D. plate
 Series 5000-6000-7000-8000 with 283
 cu. in. engine ----- Yellow I.D. plate
 Series 9000-10000 with 322 cu. in.
 engine ----- Green I.D. plate